

## Bodybuilder's Bulletin

14 July 2008

**Bulletin No. 105 (to be read in conjunction with Bulletin No. 103)**

### Power Supply and Ground Connections for Auxiliary Consumers

It should be noted that it may not be possible to add connections for additional consumers to Pins 90 and 91 on the rear of the Central Electrics board for current TG product (all models).


This is because there may be insufficient room for the lock nut to secure correctly after insertion of the additional terminals.

There must always be at least one full thread visible beyond the locking medium once the nut is fully tightened.

Where extra space is required, it is possible to install a new contact bridge (81.25908.0067) after first removing the original items and discarding them – see photos below. Nuts to be tightened to 5.5 Nm.



(existing version)

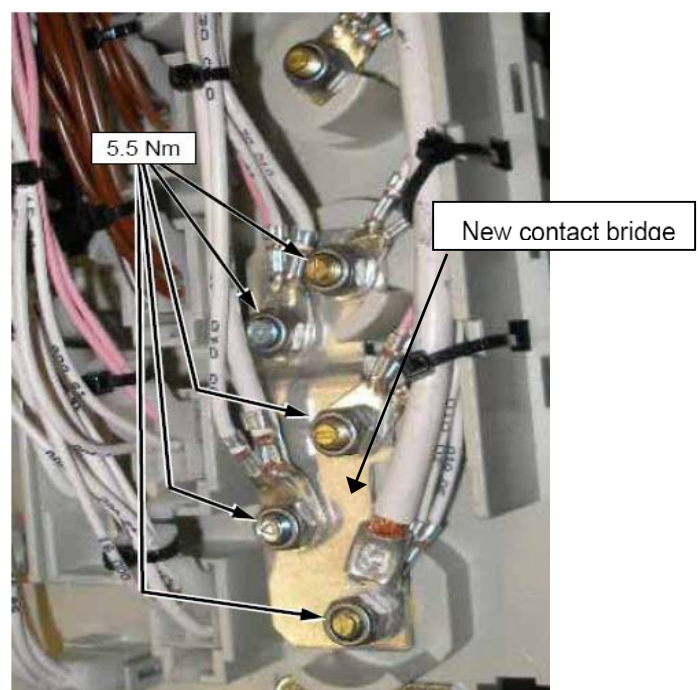

(modified version)

*Should you have any queries on the above, please contact Product Engineering on 01793 448170 or email [bodybuilder@man.co.uk](mailto:bodybuilder@man.co.uk).*

**Please circulate and then retain in the Bodybuilder's Manual**